


MONUMENT RECORD

Corner ID: **CICr_S07**

Center Quarter Corner



Section 11- T07N-R01W, 2nd P.M.

Clear Creek Township, Monroe County, Indiana

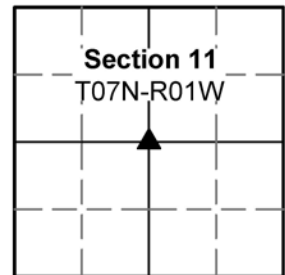

MONUMENT: Describe monument set or found (Include material type, scribing, distance above/below grade, dimensions.)
5/8" rebar with damaged cap found 0.4' above grade

MONUMENT LOCATION SKETCH:

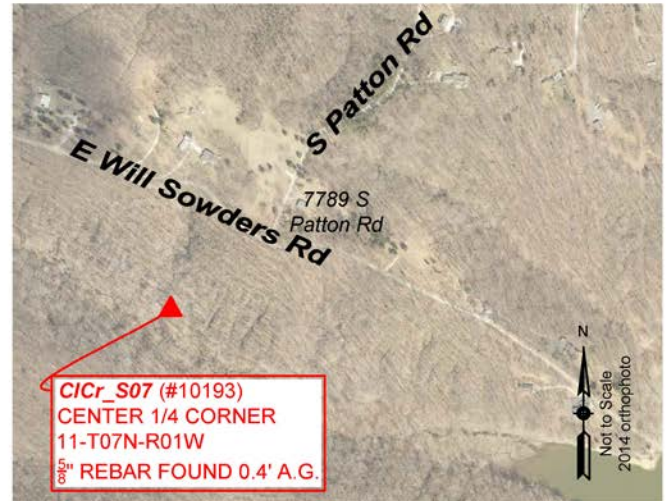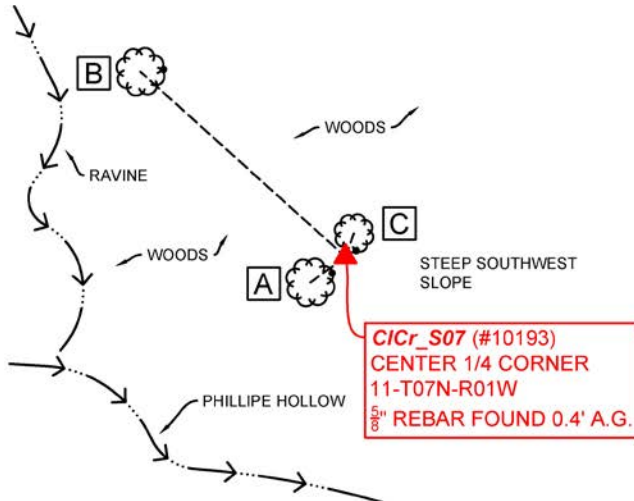

WITNESS MONUMENT TIES

BT diameters are noted as dbh and are measured approximately 4.5' above ground. Bearings are measured from the monument to the center of the BT, distances are measured from the monument to the mag nail.

ID	BEARING	DISTANCE	DESCRIPTION
Witness A	S 54d W	6.9'	Mag nail set in hack 0.75' above grade on the northeast side of a 9" sugar maple
Witness B	N 48d W	43.9'	Mag nail found 0.8' above grade on the east side of a 24" tulip
Witness C	N 20d E	4.0'	Mag nail found 0.4' above grade in the south root of an 8" sugar maple

PHOTO IDENTIFIED: Photo Date: 3/23/2018



Photo Orientation & Description: Looking southwest at CICr_S07



Photo Orientation & Description: Looking northwest at CICr_S07



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 1 of 2


MONUMENT RECORD

Corner ID: **CICr_S07**

Center Quarter Corner

Section 11- T07N-R01W, 2nd P.M.

Clear Creek Township, Monroe County, Indiana

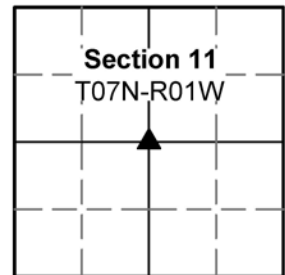

ORIGINAL OR SUBSEQUENT SURVEY EVIDENCE FOUND: *Include, search area or areas, search procedure, etc.*

Date of Field work/Search: 4/11/2017, 3/23/2018 By: RSO, TER, & ERS Monument Found: 5/8" rebar BTs or Reference Objects Found: All ties found per 2013 tie sheet Project #: CICr_2018 Field Book: 50/23, 51/52 Equipment: The basis of bearings is Grid North System NAD83(2011)/Indiana West NAVD 88, Epoch 2010.0000, geoid12b_conus.db3, US Survey Feet, derived from GPS observations utilizing a Javad Triumph LS Rover and a Javad Triumph 2 Base. Static observations were post-processed using the JAVAD GNSS Data Online Processing Service (DPOS). Coordinate data was collected with a Javad Triumph LS Rover or radially with a conventional total station (Sokkia Set 510) from points established by GPS. Distances to witness ties were collected with a Leica Disto laser distance meter. Bearings to witness ties were collected with the internal magnetic compass of the Javad Triumph LS and were automatically adjusted to grid north and are approximately shown hereon for reference. Priority should be given to provide distances over bearings Notes: There is a Monroe County "Protect Nearby Survey Marker" sign attached to the 9" sugar maple referenced as Witness A. The sign is 5' above grade on the north side of the tree facing the monument.

OTHER EVIDENCE: *Describe corner location relative to nearby features and how to reach the corner location – note fences, roads, timber cutting lines, mow lines, clearings, plantings, streams, topo changes, etc.*

The monument is on the side of a steep southwest facing slope less than 100' from the valley floor. There are east/west fence remains near the corner.

MONUMENT PRESERVATION: *Describe work done to preserve existing monument.*

Mag nail added and referenced as a new tie on the 9" sugar maple that has the Monroe Co Survey Marker sign attached. A t-post was set 3.1' above grade 0.4' southwest of the monument.

THEORY OF LOCATION: *Describe the theory of location for acceptance of this monument. Include monument origin and associated uncertainty.* The 5/8" rebar with damaged cap was previously witnessed and the Monument Record prepared under the direction of the Monroe County Surveyor, Kevin Enright, on May 01, 2013 and accepted by the Monroe County Surveyor Review Board on May 21, 2013. The 2013 Monument Record accepted the 5/8" rebar with damaged cap per a Will Sowders Road survey by Ben E. Bledsoe on file in the Recorder Office Instrument No. 2012006701.

CERTIFICATIONS:



Date:10/26/2020
Trohn Enright-Randolph
Monroe County Surveyor



Date:10/22/2020
Accepted by the Monroe
County Surveyor Review
Board



OFFICE OF THE MONROE COUNTY SURVEYOR • Trohn Enright-Randolph

119 W 7th Street, Bloomington, IN 47404 • 812-349-2570 • surveyoroffice@co.monroe.in.us

Page 2 of 2

MONUMENT RECORD
State of Indiana - County of Monroe

Section: 11

Township: 07 North

Range: 01 West

Corner ID: ClCrS-07



Monument Description & Remarks: 5/8" Rebar with (chewed up) cap 4" above ground.

Survey Sign 5ft above ground at point B

References On File: Ben E. Bledsoe survey, Will Sowders Road (2010), on file in Recorder Office (IN2012006701)

RECOVERY TIE DRAWING

Field Book 46 Page No. 65

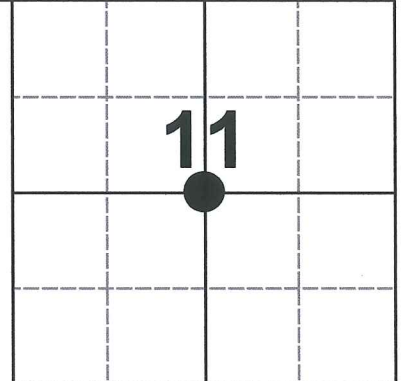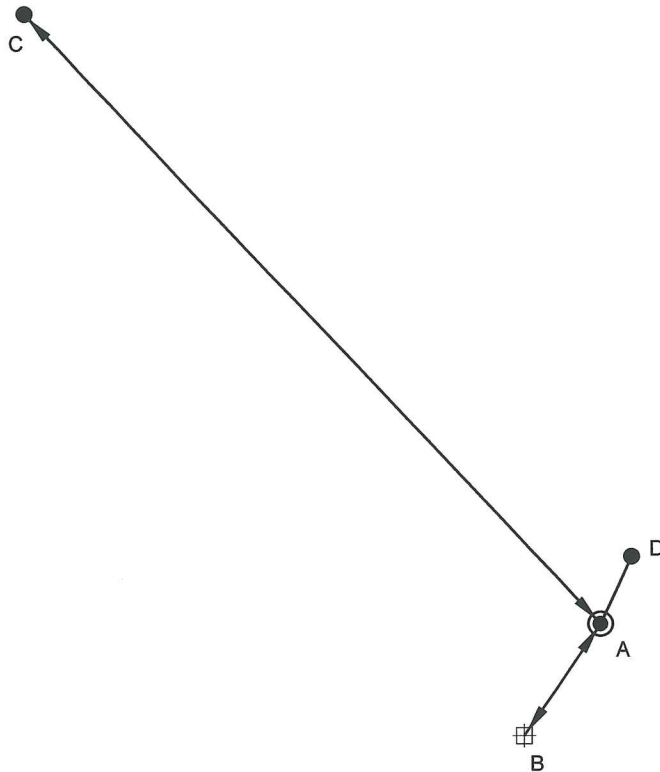

- A - 5/8" Rebar with cap
- B - S 35° W 7.09' to Survey Sign on 9" Sugar Maple
- C - N 43° W 43.9' to MAG nail in 23" Tulip Poplar
- D - N 25° E 3.9' to MAG nail in 8" Sugar Maple

Not To Scale
Compass Bearing Magnetic North




I, Kevin P. Enright, Monroe County Surveyor, hereby certify that this document was prepared under my direction in accordance with the provisions of section 36-2-12-1 of the Indiana Code; and the above data is given under my hand and seal this 1st day of May, 2013.

Kevin P. Enright

Administered by the Monroe County Surveyor Review Board

5-21-2013

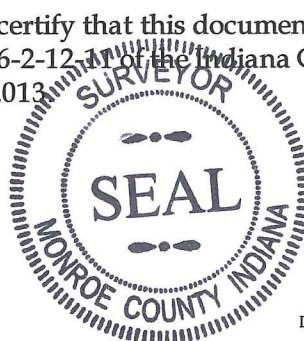

Drawn by: T.E.R. Entry date: May 02, 2013